



BKSB-1024 Issue Date 06-04-2008

Issue: On radios programmed with Keypad function selections, a phantom "enter key" press causes exit from keypad function menu. This results in disallowing multiple 'FCN' key options.

Affected Models: GPH5102XCMD portable analog command radios.

Recommended Action: Update radio firmware. It is recommended by BK Radio that this upgrade be performed on all GPH5102XCMD radios with a serial number below 0803000.

(*Please note: This program will validate the firmware revision level within the unit before writing any information. The update will only be written if required.*)

Parts and Equipment Requirements:

- 1- LAA0725 Programming Cable
- 1- Software Patch from RELM.com

Procedure:

- 1) Verify the radio firmware revision installed in your GPH-CMD by pressing and holding the "1" button on the radio keypad. If the radio does not show the current revision number the update is needed. **Current revision: 38596163**
- Download, install and run the GPH-CMD Field update program (GMH-CMD_0608.zip) from the service section of the www.relm.com (http://www.relm.com/Sections/Service/BK_Firm.asp)