

Service Bulletin

BKSB-1040 Issue Date 2/3/15

7100 Technology Drive West Melbourne, FL 32904 1-800-422-6281

NOTE: THIS BULLETIN APPLIES TO THE KNG-M SERIES AND KAA0660

Issue: The key ring on Hirose connector of the KAA0290 and KAA0276 is breaking.


Importance: Corrective action as needed

Affected Models: KAA0290 Smart Mic & KAA0276 Standard Mic

Recommended Action: To reduce the risk of damaging the connector, inform the end user to securely fasten the threaded collar of the connector before using the microphone.

Issue Details:

There has been isolated cases where the 'key ring' of the connector is being sheared-off or damaged if the connector is mated to the radio's microphone connector without securely fastening the 'threaded collar'. The 'key ring' was designed to guide the connector, and the threaded collar is used to secure the connector; therefore, the collar must be secured to the mating threads before using the microphone.

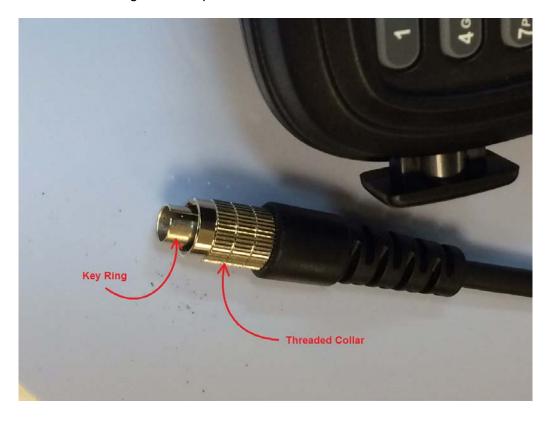



7100 Technology Drive West Melbourne, FL 32904 1-800-422-6281

Service Bulletin

BKSB-1040 Issue Date 2/3/15

INCORRECT:



CORRECT:

